


CHAP. 4 AIRFRAME S.P. 423 A.L. 4 SHEET 1 OF 2	SERVICING PROCEDURE F53 T55	BAC F53 & T55 (SA) 5A3A Section 1 2nd Edition
Main Undercarriage Door Locking Mechanism - Drag Link Cracking		AFSC 43151
Safety and Servicing Notes are to be complied with throughout the work detailed on this card.		TIME EST
SPECIAL TOOLS AND EQUIPMENT Ardrox dye penetrant kit.		ASSOCIATED PROCEDURES SP106 (AF)
<u>43151</u>		
1. EXAMINATION		
1.1 Drag link assembly left and right (Part No. EBL-20-2255) (See Fig.1).	(i) Remove. (ii) Look for cracks in eye-end (Ardrox dye penetrant). (iii) Refit.	
NOTE: Item 2 is applicable only if cracks are found in Sub-item 1.1 Operation (ii).		
2. RECTIFICATION		
2.1 Drag link assembly.	Replace (See Fig.1).	
3. COMPLETION		
3.1 Undercarriage operating system.	(i) Adjust as necessary. (ii) Carry out functional checks (SP 106 (AF)).	
Continued Overleaf		

Safety and Servicing Notes are to be complied with throughout the work detailed on this card.

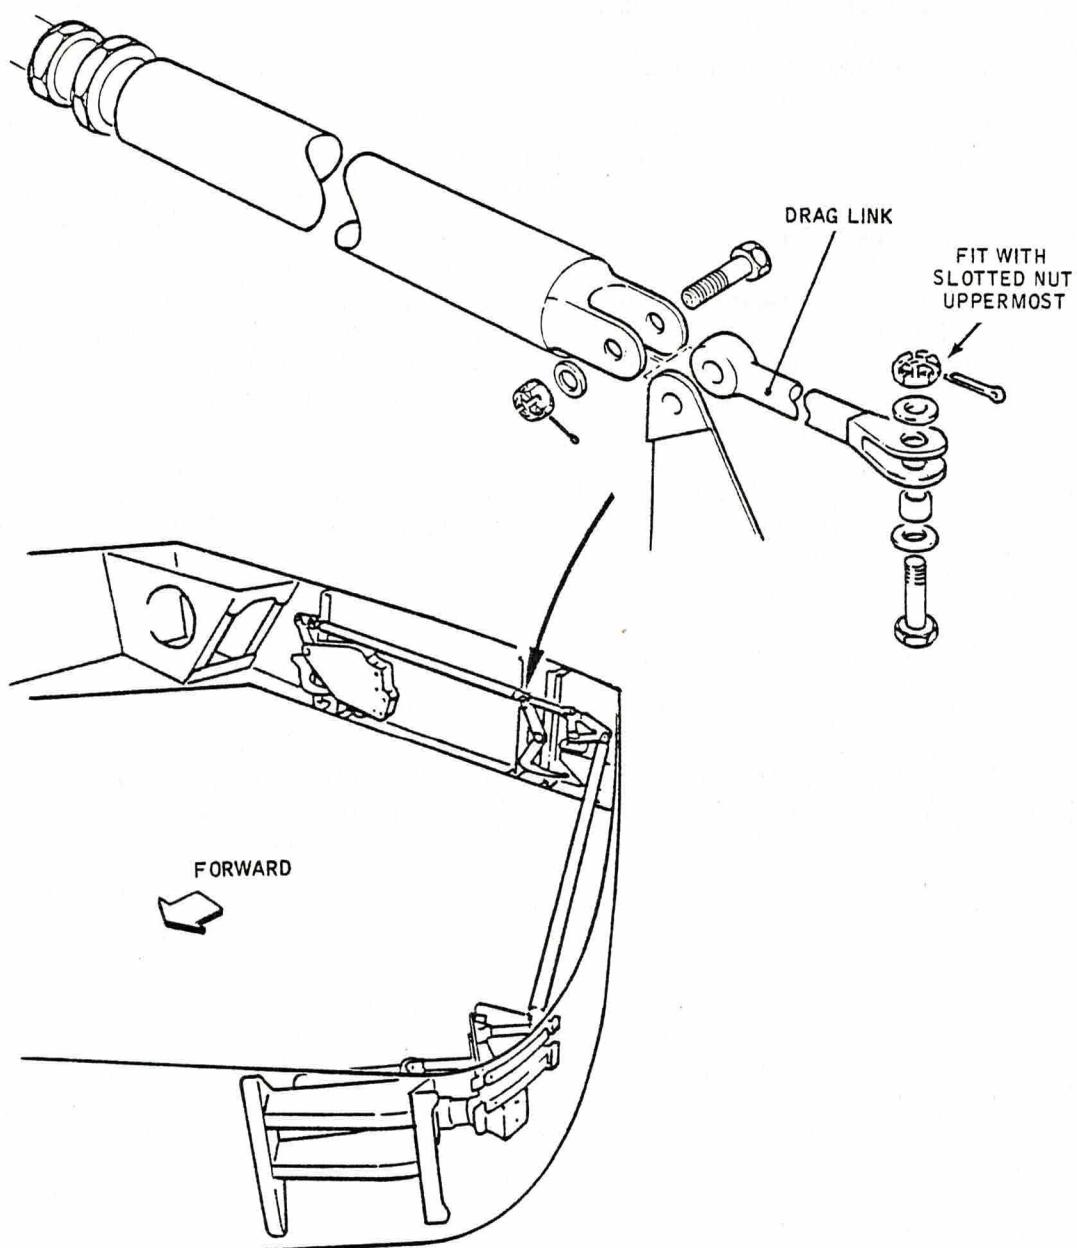

MAIN UNDERCARRIAGE DRAG LINK ASSEMBLY
FIGURE 1

This file was downloaded
from the RTFM Library.

Link: www.scottbouch.com/rtfm

Please see site for usage terms,
and more aircraft documents.

