

Hunter Two Seater
Issued with A/L No.3

EQUIPMENT AIRCRAFT — GM COMPASS


Ref. No.	Part No.	Description	No. Off	Material Specification	M.R. Class of Store	Plate No.
3	+ D.318007	G.M. 'AIM' 400 COMPASS INSTALLATION (Mod.2583)	-	-		
3	DHS.208/10/B	Bolt	3	-		
3	C.318001	Cable assy., GC.21 (See Cable Chart)	1	-		
3	B.318000	Cable assy., GC.22 (See Cable Chart)	1	-		
3	B.316384	Cable assy., GC.23 & flux detector 254/11 (See Cable Chart)	1	-		
3	HP-4N	Clip, VN 472	1	-		
3	F&W 823683E	Mounting, 'AIM' 400 flux detector bracket	1	-		
3	Ross Courtney TY-23M	Strap, cable	20	-		
3	Ross Courtney TY-25M	Strap, cable	20	-		
3	823682E	Support	1	-		
3	D.314319	G.M. COMPASS INSTALLATION, ASSEMBLY	-	-		
6B/635	-	Amplifier, type "B"	1	-	A	
	B.314243	Cable, G.C.1, group (See Cable Chart)	1	-	-	
	B.220056	Cable, G.C.2, group (See Cable Chart)	1	-	-	
	B.314245	Cable, G.C.6, group (See Cable Chart)	1	-	-	
	B.314246	Cable, G.C.7, group (See Cable Chart)	1	-	-	
	B.314247	Cable, G.C.8, group (See Cable Chart)	1	-	-	
	B.318428	Cable, G.C.11, group (See Cable Chart)	1	-	-	
	Std.2046/23/24	Clip, securing cable	2	-		6
	Std.2045/23/24	Clip, securing cable	1	-		6
11384	Std.2046/34/22	Clip, securing cable	1	-		6
	C.263547	CLIPPING OF CABLES IN SPINE, ASSEMBLY	-	-		
	B.208590	Cable, GC.3, group (See Cable Chart)	1	-	-	
9664	Std.2045/22/24	Clip, securing cable	4	-		6
5F/9454141	NY.18007A	Strapping	QR	-	C	
5F/9138822	NY.3342	Stud	QR	-	C	
	G.232011	INSTALLATION OF G.M. COMPASS, ASSEMBLY (Aft of frame 40 only)	-	-		
	B.208588	Cable, GC.4, group (See Cable Chart)	1	-	-	
	B.208589	Cable, GC.9, group (See Cable Chart)	1	-	-	
7847	F.210058	Clip, securing coupler plug	1	L.72	C	
9489	F.199302	Clip, securing cable at fin former	1	DTD.610	C	
8277	F.213231	Fairlead, at frame 52	1	LFS.21	C	
	F.213415	Hook, at frame 52	2	L.72		
	F.213232	Strip, rubbing, at frame 52	1	DTD.171		
6B/1993	-	Unit, detector, type "A"	1	-	A	
or	-	Unit, detector, type "B"	1	-	A	
6B/2906	-	Mounting, type "A"	1	-	A	
6B/438	-	Plate, cover	1	L.72		
	F.208641	Screw	4			
	Std.1606/31/C20	Strapping	QR		C	
5F/9454141	NY.18007A	Stud	QR		C	
5F/9138822	NY.3342	Box, corrector control	1			
6B/2569	-					


+ Swiss fit


EQUIPMENT AIRCRAFT - GM COMPASS

Hunter Two Seater
Issued with A/L No.2

Ref. No.	Part No.	Description					No. Off	Material Specification	M.R. Class of Store	Plate No.
		1	2	3	4	5				
SUMMARY OF STOCK ITEMS										
28D/1007971	A25. 1B	Boit,	4	B.A.			-	-	-	
28D/1010658	A25. 1B	Boit,	4	B.A.			-	-	-	
28D/9419452	A25. 3B	Boit,	4	B.A.			-	-	-	
28D/9138768	A25. 1C	Boit,	2	B.A.			-	-	-	
28D/9436920	A25. 1C	Boit,	2	B.A.			-	-	-	
28D/9133011	A25. 2C	Boit,	2	B.A.			-	-	-	
28D/1011021	A25. 16C	Boit,	2	B.A.			-	-	-	
28D/12953	A28. 1B	Boit,	4	B.A.			-	-	-	
28D/1007982	AS. 1248. 1C	Boit,	2	B.A.			-	-	-	
28M/10288	AGS. 2001. C1	Nut,	2	B.A.			-	-	-	
28M/10327	AGS. 2002. B1	Nut,	4	B.A.			-	-	-	
28M/10328	AGS. 2002. C1	Nut,	2	B.A.			-	-	-	
5K/88	AGS. 1658/1	Nut, gland					-	-	-	
5K/41	AGS. 1653/1	Sleeve					-	-	-	
5K/51	AGS. 1654/2	Sleeve					-	-	-	
28S/9992525	A32. B12	Screw,	4	B.A.			-	-	-	
28S/2418	A44. C20	Screw,	2	B.A.			-	-	-	
28W/9419402	SP. 13. C	Washer					-	-	-	
28W/9419474	SP. 15. B	Washer,	4	B.A.			-	-	-	
28W/9419475	SP. 15. C	Washer,	2	B.A.			-	-	-	

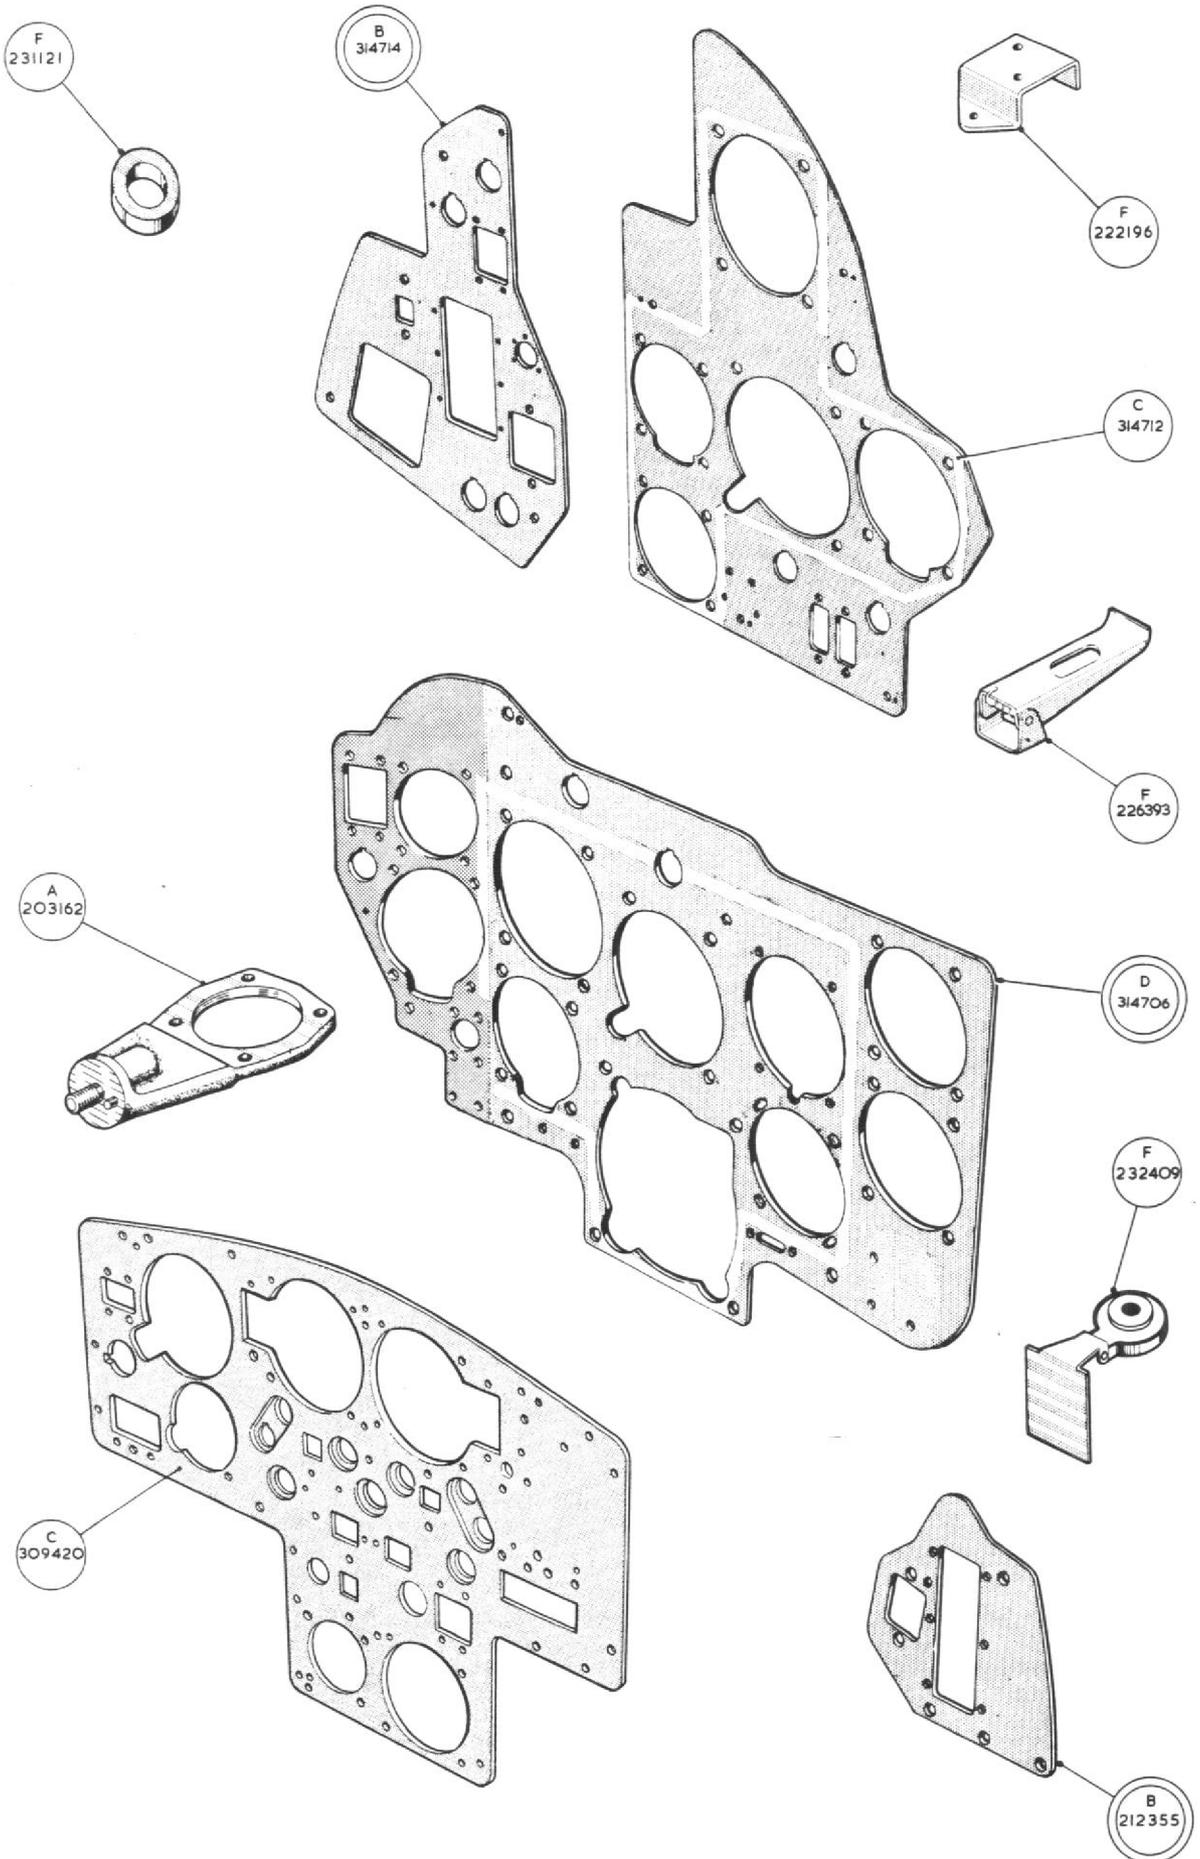



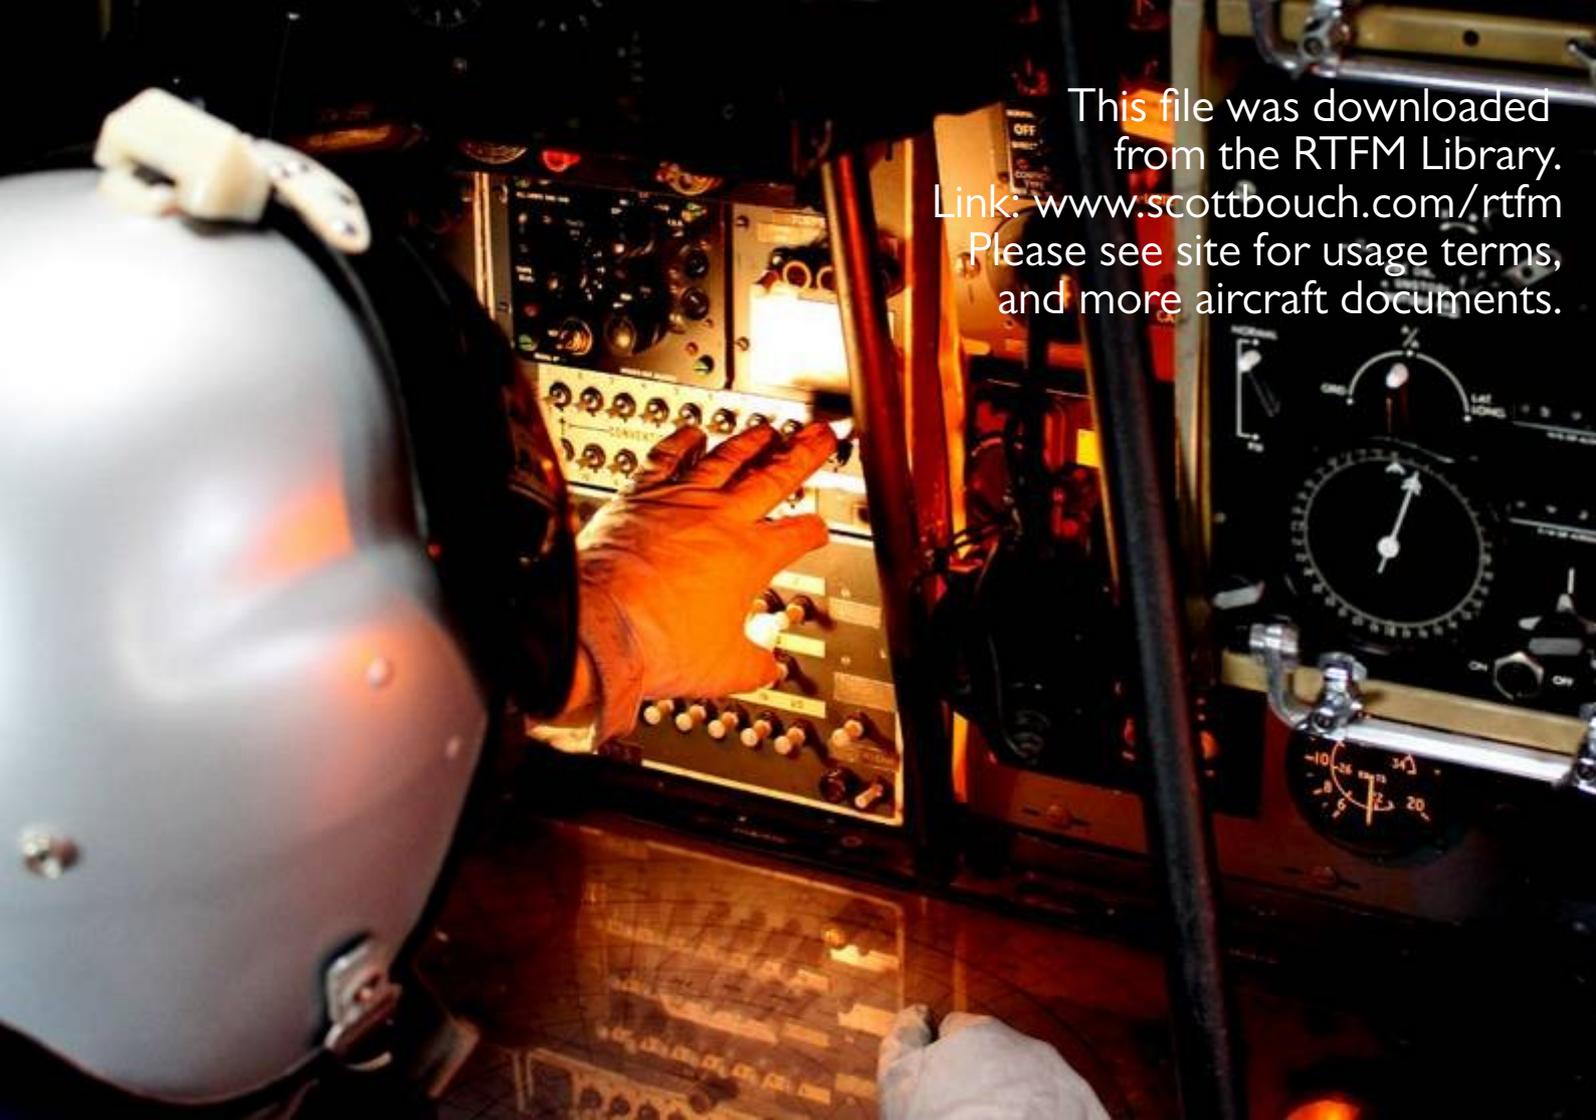

This file was downloaded
from the RTFM Library.
Link: www.scottbouch.com/rftm
Please see site for usage terms,
and more aircraft documents.