

INSTALLATION OF AILERON AND RUDDER TRIM INDICATOR, CODED "DH"

Ref. No.	Part No.	Description	No. off	Material Specification	Class of Score or L.M	Place No.
	—	INSTALLATION OF AILERON AND RUDDER TRIM INDICATOR, CODED "DH"	1	—	—	
	—	INSTALLATION ON RUDDER TRIM BOX, CODED "G" AT PILOT'S L.H. CONSOLE (Drg. Nos. 10-20 N 11421 and 10-22 N 1223A)	1	—	—	
	10-20 N 8709A	CABLE , coded "G.A-Q," assembly	1	—	ECC	
6A/6011	SANGAMO WESTON S216/2/18	INDICATOR , aileron and rubber trim Attachments for S216/2/18, Indicator :—	1	—	P	
6A/3823	—	Clamp	1	—	C	
28S/17229	AS.2992/6B	Screw, 4 BA	1	—	C	
	—	INSTALLATION AT REAR PRESSURE BULK-HEAD, CODED "Q" (Drg. Nos. for use on Pre Mod. 2 A/C :— 10-20 N 8553, 10-20 N 7907 and 10-20 N 7615A) (Drg. Nos. for use on Mod. 2 A/C :—10-20 N 11421, 10-20 N 10635 and 10-20 N 14755A)	1	—	—	
	—	BLOCK , fuse, coded "A," group	1	—	—	
	—	BLOCK , fuse, 12-way, coded "A" (See sub-section EBV)	1	—	—	
10H/23864	—	FUSE , 5 amp.	1	—	C	EAP1
	—	BLOCK , fuse, coded "B," group	1	—	—	
	—	BLOCK , fuse, 12-way, coded "B" (See sub-section EBV)	1	—	—	
10H/23864	—	FUSE , 5 amp.	1	—	C	EAP1
	DHS.456/20	BLOCK , terminal, 20-way, coded "AF," group	1	—	—	
	—	BLOCK , terminal, 20-way, assembly (For breakdown see DHS.Data Sheet)	1	—	—	EAP1
5X/9149643	PLESSEY CZ.25111	COVER , terminal block	1	—	C	
12732	10-20 N 8085	PILLAR , fixing, 4 BA	2	S.93	C	EAP1
	10-20 N 14089A	CABLE , bung "Q3," assembly (Mod. 249) (For cables circuit coded "DH")	1	—	ECC	EAP1
	10-20 N 8755A	CABLE , bung "Q4," assembly (Pre Mod. 2) (For cables circuit coded "DH")	1	—	ECC	EAP1
	10-20 N 12551A	CABLE , bung "Q4," assembly (Mod. 2) (For cables circuit coded "DH")	1	—	ECC	EAP1
	—	INSTALLATION AT STARBOARD WING DECK PANEL, CODED "FB" (Drg. Nos. for use on Pre Mod. 2 A/C: 10-20 N 8863 and 10-20 N 8803A/3) (Drg. Nos. for use on Mod. 2 A/C :— 10-20 N 11213 and 10-20 N 14863A)	1	—	—	
	DHS.456/20	BLOCK , terminal, 20-way, coded "B," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
	—	Attachments for DHS.456/20, Block :—				
28D/12690	AS.1246/5B	Bolt, 4 BA	2	—	C	
28W/9419474	SP.15/B	Washer	2	—	C	
	DHS.456/20	BLOCK , terminal, 20-way, coded "D," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
	—	Attachments for DHS.456/20, Block :—				
14987	10-20 N 8231	Pillar, fixing, 4 BA	2	S.92	C	EAP1
28W/9419474	SP.15/B	Washer	2	—	C	

ELECTRICAL INSTALLATIONS

INSTALLATION OF AILERON AND RUDDER TRIM INDICATOR, CODED "DH "

Ref. No.	Part No.	Description	No. off	Material Specification	Class of Store or L.M.	Plate No.
	DHS.456/20	BLOCK , terminal, 20-way, coded "E," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
14987 28W/9140967	10-20 N 8231	Attachments for DHS.456/20, Block :— Pillar, fixing, 4 BA	2	S.92	C	EAP1
	SP.18/B	Washer	2	—	C	
	10-20 N 9/126 Mk. 1	CABLE , coded "15.B.FB.DHA-DHA.ZA.A.3," assembly	1	—	ECC	EAP1
	10-20 N 9/126 Mk. 2	CABLE , coded "16.B.FB.DHA-DHA.ZA.A.6," assembly	1	—	ECC	EAP1
	10-20 N 9/126 Mk. 3	CABLE , coded "17.B.FB.DHA-DHA.ZA.A.4," assembly	1	—	ECC	EAP1
	10-20 N 9/126 Mk. 4	CABLE , coded "18.B.FB.DHA-DHA.ZA.A.2," assembly	1	—	ECC	EAP1
	10-20 N 9/126 Mk. 5	CABLE , coded "3.D.FB.DHA-DHA.ZA.A.7," assembly	1	—	ECC	EAP1
	10-20 N 9/126 Mk. 6	CABLE , coded "4.D.FB.DHC-DHC.ZA.A.8," assembly	1	—	ECC	EAP1
	10-20 N 6841A	CABLE , coded "VM7-FB," assembly	1	—	ECC	EAP1
	—	INSTALLATION AT WING-FOLD, STAR BOARD (Drg. Nos. for use on Pre Mod. 2 A/C :—10-20 N 2275 and 10-20 N 2613) (Drg. Nos. for use on Mod. 2 A/C :—10-20 N 11511 and 10-20 N 11513)	1	—	—	
	10-20 N 6837A	CABLE , coded "VM7-XH7," assembly	1	—	ECC	EAP1
	10-20 N 6839A	CABLE , coded "XH7-XN.A," assembly	1	—	ECC	EAP1
	—	INSTALLATION AT STARBOARD WING RIB No. 8 (Drg. Nos. 10-20 N 2207 Pre Mod. 2, 10-20 N 11357 Mod. 2)	1	—	—	
	DHS.456/20	BLOCK , terminal, 20-way, coded "A," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
28D/12690	AS.1246/5B	Attachments for DHS.456/20, Block : Bolt, 4 BA	2	—	C	
	—	INSTALLATION BETWEEN WING RIBS Nos. 9 and 10, STARBOARD (Drg. No. 10-20 CF 9333)	1	—	—	
	—	TRANSMITTER , aileron position, coded "YK," group	1	—	—	
17205	10-20 CF 7139	SLEEVE , mounting	1	—	C	EAZ1
	—	Attachments for 10-20 CF 7139, Sleeve :—				
28D/9133013	A25/5C	Bolt, 2 BA	1	—	C	
28M/13121	A27/CS	Nut, 2 BA	1	—	C	
28P/1007741	SP.9/C8	Pin, split	1	—	C	
28S/14665	A55/C6	Screw, 2 BA	1	—	C	
28VV/9419402	SP.13/C	Washer	1	—	C	
	10-20 N 11225A	TRANSMITTER , aileron position, assembly	1	—	—	
	10-20 N 11225A/ CABLES	CABLE , assembly	1	—	ECC	EAZ1


INSTALLATION OF AILERON AND RUDDER TRIM INDICATOR, CODED "DH"

Ref. No.	Part No.	Description	No. off	Material Specification	Class of Store or L.M.	Place No.
6A/—	SANGAMO WESTON FD.967/S.194	TRANSMITTER	1	—	—	EAZ1
28D/9138768	A25/1/2C	Attachments for 10-20 N 11225A, Transmitter :—	1	—	C	
28D/9133011	A25/2C	Bolt, 2 BA, at forward housing	1	—	C	
6746	10-20 CF 7083	Housing, ball joint	2	—	C	EAZ1
28P/1007741	SP.9/C8	Pin, split	4	—	C	
28N/10378	AGS.385/C	Plug, ball joint	2	—	C	
6747	DHS.775/C/3	Washer, at forward housing	1	—	C	EAP1
28W/9419402	SP.13/C	Washer, at rear housing	1	—	C	
—	—	INSTALLATION AT STARBOARD BOOM JOINT (Drg. Nos. 10-20 N 2003 and 10-20 N 13787)	1	—	—	
—	DHS.456/20L	BLOCK , terminal, 20-way, coded "A," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
28D/12138	AS.1246/10B	Attachments for DHS.456/20L, Block :—	2	—	C	
26DV/12296	DHS.489/5	Bolt, 4 BA	2	PVC	C	
—	10-20 N 9/126 Mk. 10	CABLE , coded "2.A.ZA.DHA-DHA.ZX.C.4," assembly	1	—	ECC	EAP1
—	10-20 N 9/126 Mk. 7	CABLE , coded "3.A.ZA.DHA-DHA.ZX.C.1," assembly	1	—	ECC	EAP1
—	10-20 N 9/126 Mk. 9	CABLE , coded "4.A.ZA.DHA-DHA.ZX.C.3," assembly	1	—	ECC	EAP1
—	10-20 N 9/126 Mk. 8	CABLE , coded "6.A.ZA.DHA-DHA.ZX.C.2," assembly	1	—	ECC	EAP1
—	10-20 N 9/126 Mk. 11	CABLE , coded "7.A.ZA.DHA-DHA.ZX.C.5," assembly	1	—	ECC	EAP1
—	10-20 N 9/126 Mk. 12	CABLE , coded "8.A.ZA.DHC-DHC.ZX.A.5," assembly	1	—	ECC	EAP1
—	—	INSTALLATION AT STARBOARD FIN ... (Drg. Nos. 10-20 N 2003, 10-20 CF 7055)	1	—	—	
—	DHS.456/5L	BLOCK , terminal, 5-way, coded "ZX/A," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
28D/12690	AS.1246/5B	Attachments for DHS.456/5L, Block :—	2	—	C	
—	DHS.456/5	BLOCK , terminal, 5-way, coded "ZX/C," assembly (For breakdown see DHS. Data Sheet)	1	—	—	EAP1
28D/12690	AS.1246/5B	Attachments for DHS.456/5, Block :—	2	—	C	
—	—	TRANSMITTER , rudder position, coded "ZW," group	1	—	—	
—	10-20 N 8935A/ CABLES	CABLE , assembly	1	—	ECC	EAP1

ELECTRICAL INSTALLATIONS

INSTALLATION OF AILERON AND RUDDER TRIM INDICATOR, CODED "DH"

Ref. No.	Part No.	Description 1 2 3 4 5 6	No. off	Material Specification	Class of Store or L.M	Plate No.
28D/9133011	A25/2C	Attachments for FD.917/S.194, Transmitter :—	1	—	C	
28D/9138768	A25/1/2C	Bolt, 2 BA, at lower housing	1	—	C	
8498	10-20 CF 7059	Bolt, 2 BA, at upper housing	1	—	C	EAP1
8497	10-20 CF 7867	Bracket, lower ball joint housing	1	—	C	EAP1
6746	10-20 CF 7083	Housing, lower ball joint	1	—	C	EAP1
28P/1007741	SP.9/C8	Housing, upper ball joint	1	—	C	EAP1
8499	10-20 CF 7869	Pin, split	3	—	C	
28N/10378	AGS.385/C	Plug, screw, lower ball joint housing	1	—	C	EAP1
28W/9419454	SP.10/C	Plug, screw, upper ball joint housing	1	—	C	
28W/9419402	SP.13/C	Washer (Fit if required at lower housing)	1	—	C	
6747	DHS.775/C/3	Washer, lower ball joint housing	1	—	C	
		Washer, upper ball joint housing	1	—	C	EAP1
32B/—	—	TAPE , identification, numbers and letters, use from Ref. Nos. 32B/1087 to 32B/1120 inclusive, as required	QR	—	C	

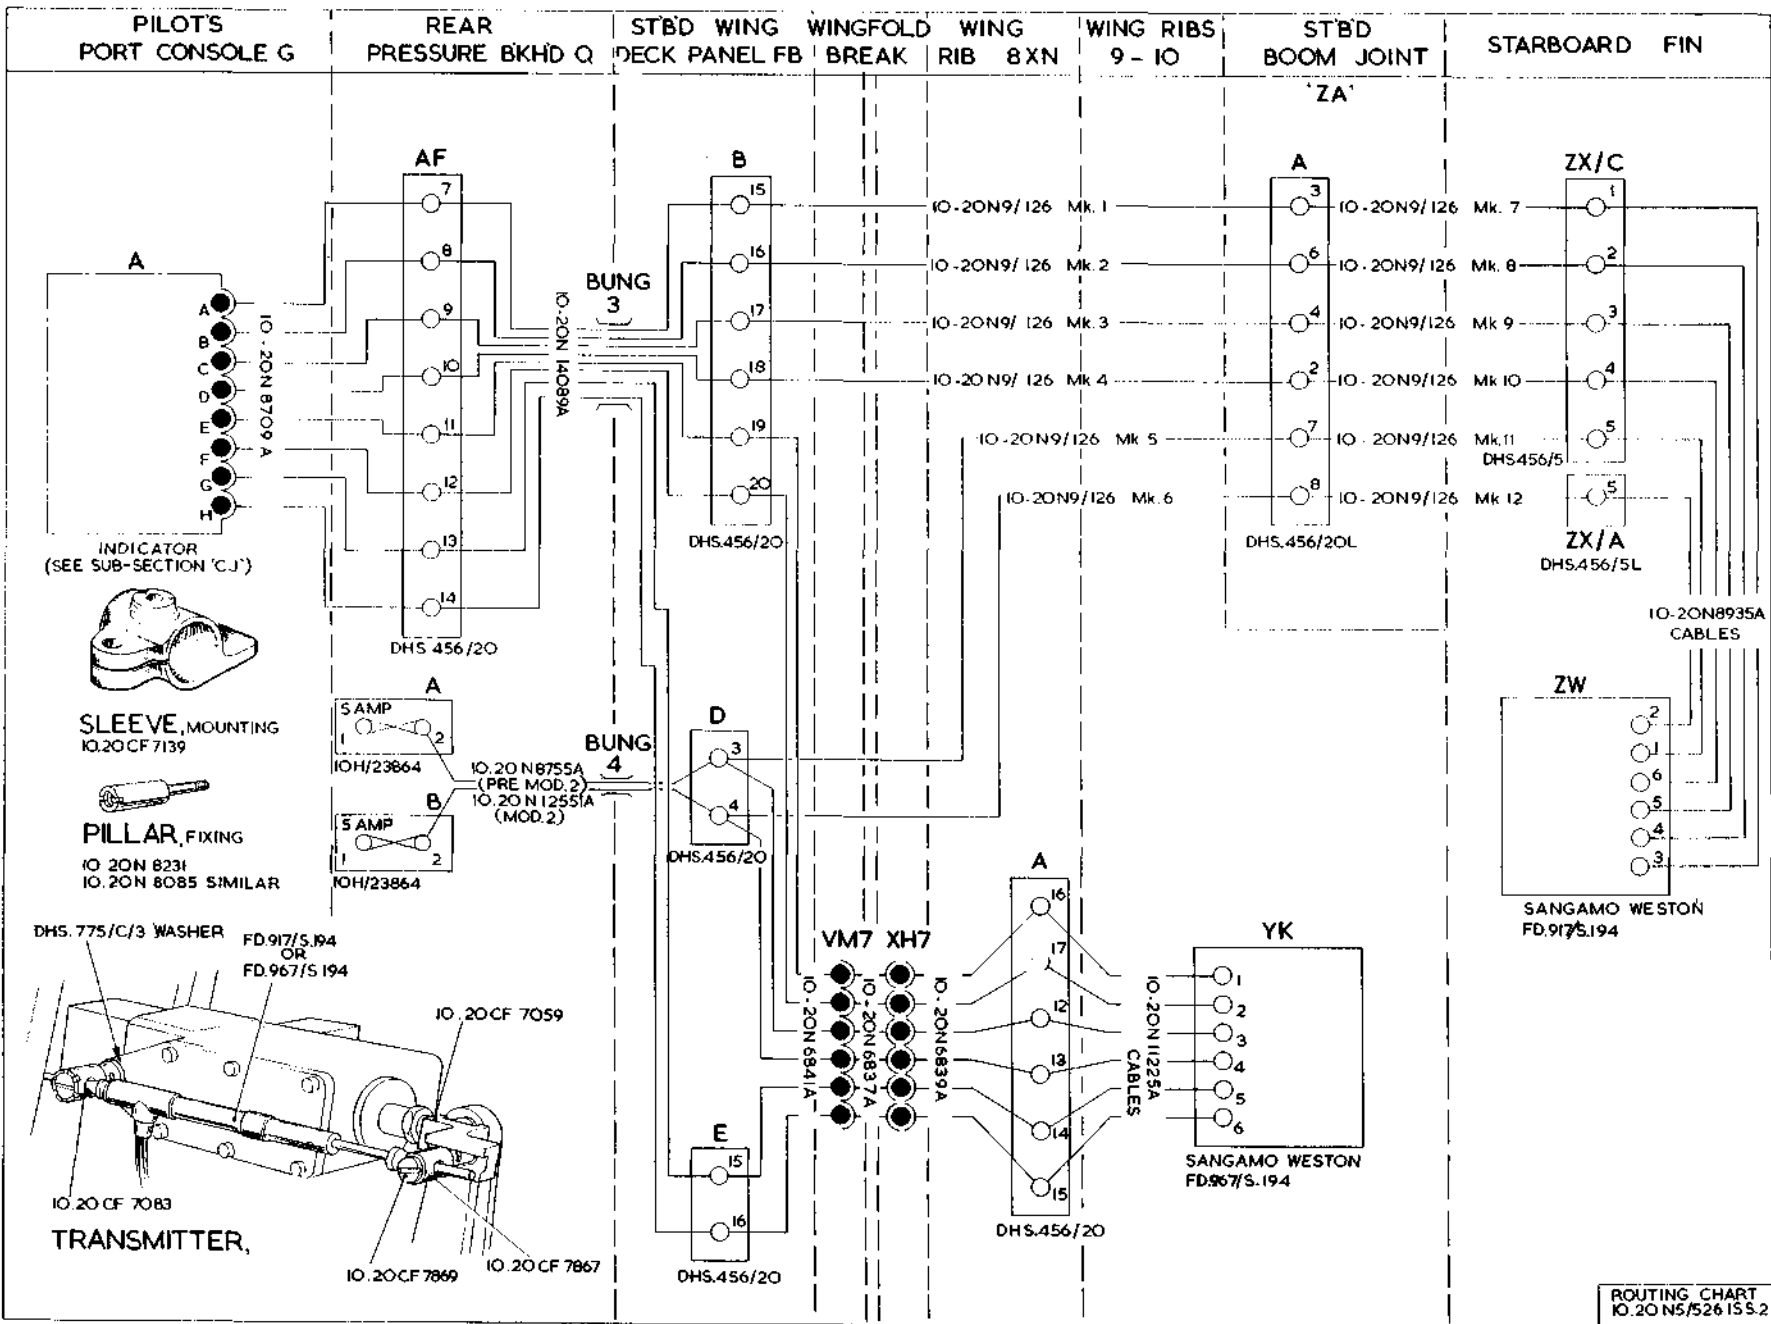

ROUTING CHART IO-20 NS/526 15 S.2

EAP.1

ELECTRICAL INSTALLATION
RUDDER AND ALERON TRIM INDICATOR
CODED DI

RESTRICTED

EAP.1

[L43]



This file was downloaded
from the RTFM Library.

Link: www.scottbouch.com/rtfm

Please see site for usage terms,
and more aircraft documents.

ENGINE
INHIBITED
DO NOT
TURN
PROP