
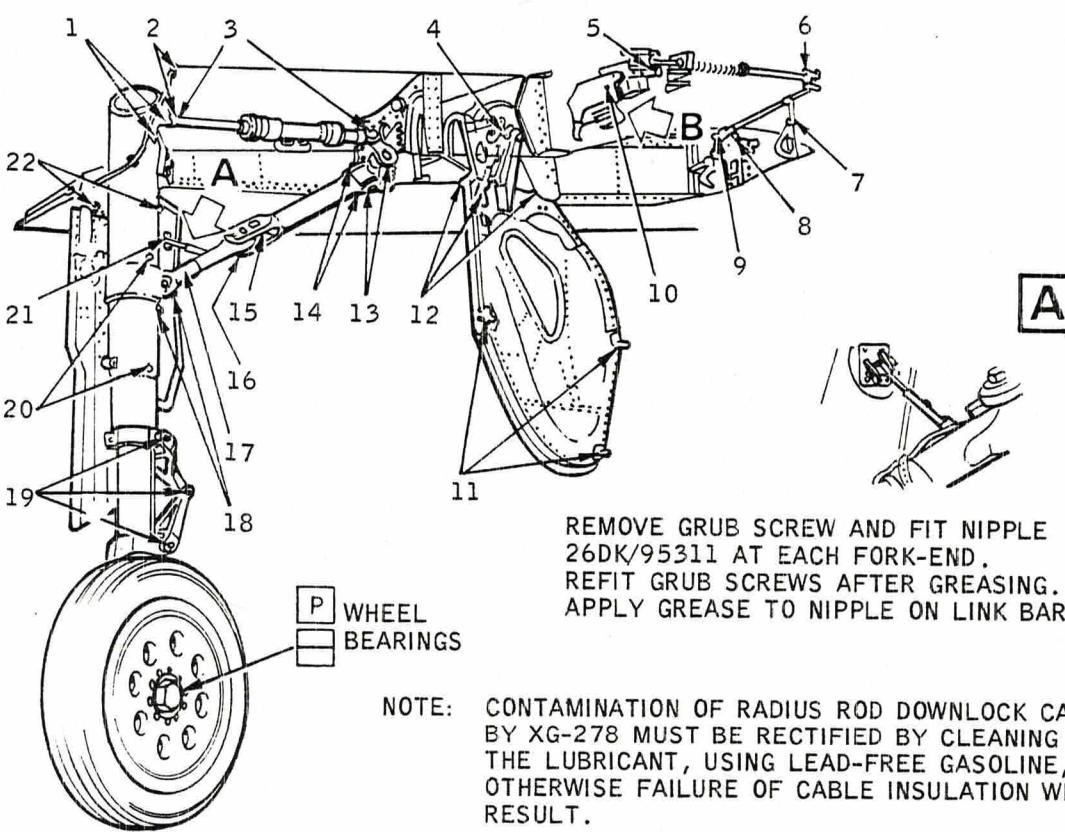


CHAP. 3 AIRFRAME S.P. 300 A.L. SHEET 1 OF 1	SERVICING PROCEDURE F53 T55	BAC F53 & T55 (SA) 5A3A Section 1 2nd Edition
Main Undercarriage		AFSC 43151 43152
Safety and Servicing Notes are to be complied with throughout the work detailed on this card.		TIME EST
 <p>REMOVE GRUB SCREW AND FIT NIPPLE 26DK/95311 AT EACH FORK-END. REFIT GRUB SCREWS AFTER GREASING. APPLY GREASE TO NIPPLE ON LINK BARREL</p> <p>NOTE: CONTAMINATION OF RADIUS ROD DOWNLOCK CABLES BY XG-278 MUST BE RECTIFIED BY CLEANING OFF THE LUBRICANT, USING LEAD-FREE GASOLINE, OTHERWISE FAILURE OF CABLE INSULATION WILL RESULT.</p>	ASSOCIATED PROCEDURES	
<p>1 SHOCK-ABSORBER STRUT PIVOT 2 FORWARD FLAP-ACTUATING LINK 3 UNDERCARRIAGE JACK 4 DOOR-JACK ATTACHMENT 5 DOOR-LATCH LEVER 6 DOOR-LATCH LEVER 7 DOOR-LATCH HOOK 8 DOOR-LATCH MICROSWITCH MECHANISM 9 DOOR-LATCH HOOK 10 DOOR MASTER-LATCH MECHANISM 11 DOOR ROLLERS 12 DOOR HINGES 13 RADIUS-ROD PIVOT SHAFT 14 RADIUS-ROD ATTACHMENT SHACKLE 15 RADIUS-ROD LOCK 16 RADIUS-ROD KNUCKLE JOINT 17 RADIUS-ROD BEARING 18 RADIUS-ROD TRUNNION ASSEMBLY 19 TORQUE-LINK PIVOTS 20 SHOCK-ABSORBER STRUT 21 AFT FLAP-ACTUATING LINK 22 FORWARD FLAP HINGES</p> <p>MAIN UNDERCARRIAGE LUBRICATION POINTS</p> <p>FIGURE 1</p> <p>SERVICING PROCEDURE INSPECTION STAGES DO NOT EXCLUDE ADDITIONAL INSPECTION STAGES INCORPORATED AS NECESSARY IN MAINTENANCE CERTIFICATION DOCUMENTS</p>	 <p>KEY TO LUBRICANTS SYMBOL NOMENCLATURE</p> <ul style="list-style-type: none"> <input type="checkbox"/> XG-287 <input type="circle"/> OX-14 <input type="square"/> XG-277 <input checked="" type="checkbox"/> P PRE-PACKED 	

This file was downloaded
from the RTFM Library.

Link: www.scottbouch.com/rtfm

Please see site for usage terms,
and more aircraft documents.

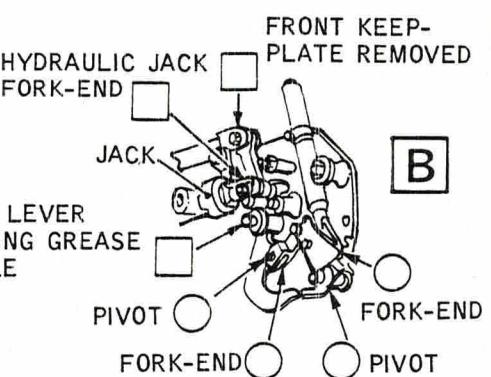